# A Novel Method for Vector Control of Faulty Three-Phase IM Drives Based on FOC Method

By Tole Sutikno

ISSN: 2088-8708

### A Novel Method for Vector Control of Faulty Three-Phase IM Drives Based on FOC Method

Mohammad Jannati\*, Nik Rumzi Nik Idris\*, Mohd Junaidi Abdul Aziz\*, Tole Sutikno\*\*

- \* UTM-PROTON Future Drive Laboratory, Faculty of Electrical Engineering, Universiti Teknologi Malaysia, 81310 Skudai, Johor Bahru, Malaysia
  - \*\* Department of Electrical Engineering, Universitas Ahmad Dahlan, Yogyakarta, Indonesia

#### Article Info

#### Article history:

Received Jun 20, 2015 Revised Aug 22, 2015 Accepted Sep 8, 2015

#### Keyword:

FOC

Open-Phase Fault Speed and Torque Oscillations Stat-Connected Three-Phase Induction Motor

#### ABSTRACT

This paper proposes a novel method for vector control of faulty three-phase Induction Motor (IM) drives based on Field-Oriented Control (FOC) method. The performance characteristics of the presented drive system are investigated at healthy and open-phase fault conditions. The simulation of the case study is carried out 4y using the Matlab/M-File software for a star-connected three-phase IM. The results show the better performance of the proposed drive system especially in reduction of motor speed and torque oscillations during open-phase fault operating.

Copyright © 2015 Institute of Advanced Engineering and Science.
All rights reserved.

#### Corresponding Author:

M. Jannati,

UTM-PROTON Future Drive Laboratory, Faculty of Electrical Engineering,

Universiti Teknologi Malaysia,

81310 Skudai, Johor Bahru, Malaysia.

Email: jannatim94@yahoo.com

#### 1. INTROIZECTION

The Field-Oriented Control (FOC) method is widely used for implementing high performance 26 tor control of three-phase Induction Motor (IM) drives. The FOC technique divides IM stator currents into flux and torque producing components. The torque is proportional to the product of these two perpendicular components and they can be treated separately. This means that the control of three-phase IM is transformed into a control system similar to the control of DC machine. Generally, there are two possibilities for the FOC technique. They are: Rotor Field-Oriented Control (RFOC) and Stator Field-Oriented Control (SFOC) [1].

In some industrial applications, such as in electric vehicle, space exploration, and etc the control of faulty electrical machines is very important [2]. These applications need a fault-tolerant control method whereby the operation of the drive system cannot be interrupted by a faulty condition mostly for safety reasons. The control of faulted machine, however, is clearly different from the control of healthy machine. By using the standard control strategies to faulted machine, significant oscillations in the motor speed and torque output will be developed [3]-[5].

In case of open-phase fault, in [6]-[12], some methods to control faulted multi-phase IMs and faulted permanent magnet synchronous motors have been proposed. These methods are limited to these customized or specialized machines and applications. In [5], [13] two techniques for FOC of three-phase IM under open-phase fault have been presented. These techniques are only applicable to vector-controlled motor drives based on current-controlled Voltage Source Inverter (VSI). In [14], [15] different methods based on voltage controller for vector control of three-phase IM under open-phase fault have been proposed. The drawback of these techniques is that these methods are not good for high performance vector control

applications as in these techniques due to the using two different transformation matrices, the drive system is sensitive to motor parameters variations.

This study shows the three-phase IM equations under open-phase fault can be modeled as two balanced forward and backward equations. Based on this, a novel FOC method for three-phase IM under open-phase is presented. The configuration of the used converter for feeding three-phase IM during open-phase fault is shown in Figure 1. During fault condition as shown in this figure, the mitting into food DC-link voltage should be connected to the neutral point of the machine as discussed in [16]. This paper is organized as follows: After introduction in section 1, in section 2, d-q model of healthy and faulty three-phase IMs is presented. Next, section 3 describes the development of the FOC algorithm, followed by presenting proposed scheme. The performance of the presented method is analyzed and checked using Matlab software in section 4 and section 5 concludes the paper.




Figure 1. Configuration of the used converter for feeding three-phase IM during open-phase fault

#### 2. MODELING OF HEALTHY AND FAULTY THREE-PHASE IMS

The d-q model of healthy and faulty three-phase IMs in the stationary reference frame (superscript "s") can be described by the following equations [13]:

$$v_{ds}^{s} = r_{ds}i_{ds}^{s} + \frac{d\lambda_{ds}^{s}}{dt} , \quad v_{qs}^{s} = r_{qs}i_{qs}^{s} + \frac{d\lambda_{qs}^{s}}{dt}$$

$$0 - r_{r}i_{dr}^{s} + \frac{d\lambda_{dr}^{s}}{dt} + \omega_{r}\lambda_{qr}^{s} , \quad 0 - r_{r}i_{qr}^{s} + \frac{d\lambda_{qr}^{s}}{dt} - \omega_{r}\lambda_{dr}^{s}$$

$$\lambda_{ds}^{s} = L_{ds}i_{ds}^{s} + M_{d}i_{dr}^{s} , \quad \lambda_{qs}^{s} = L_{qs}i_{qs}^{s} + M_{q}i_{qr}^{s}$$

$$\lambda_{dr}^{s} = M_{d}i_{ds}^{s} + L_{r}i_{dr}^{s} , \quad \lambda_{qr}^{s} = M_{q}i_{qs}^{s} + L_{r}i_{qr}^{s}$$

$$\tau_{e} = \frac{Pole}{2} (M_{q}i_{qs}^{s}i_{dr}^{s} - M_{d}i_{ds}^{s}i_{dr}^{s})$$

$$\frac{Pole}{2} (\tau_{e} - \tau_{l}) - J\frac{d\omega_{r}}{dt} + F\omega_{r}$$

$$(1)$$

In (1),  $v^s_{ds}$ ,  $v^s_{qs}$  are the 8 tor d-q axes voltages,  $i^s_{ds}$ ,  $i^s_{qs}$  are the stator d-q axes currents,  $i^s_{dr}$ ,  $i^s_{qr}$  are the rotor d-q a27 currents,  $i^s_{ds}$ ,  $i^s_{qs}$  are the stator d-q axes fluxes and  $i^s_{dr}$ ,  $i^s_{qr}$  are 19 rotor d-q axes fluxes.  $i^s_{ds}$ ,  $i^s_{qs}$  are the stator and ro 3 d-q axes resistances.  $i^s_{ds}$ ,  $i^s_{qs}$ ,  $i^s_{qs}$ ,  $i^s_{qs}$  are the stator and rotor d-q axes fluxes and  $i^s_{dr}$ ,  $i^s_{qr}$  are 19 rotor d-q axes fluxes.  $i^s_{ds}$ ,  $i^s_{qs}$  are the stator and rotor d-q axes self and mutual inductances.  $i^s_{ds}$ ,  $i^s_{qs}$  are the estator and rotor d-q axes self and mutual inductances.  $i^s_{ds}$ ,  $i^s_{qs}$  are the moment of inertia and viscous friction coefficient respectively. It can be noted that Equation (1) can be described healthy three-phase IM if,  $i^s_{ds}$ ,  $i^s_{qs}$ 

#### 3. PROPOSED METHOD FOR VECTOR CONTROL OF HEALTHY AND FAULTY IMS

In this section, a method for vector control of three-phase IM based on extended model of IM as shown in (1) is presented. It is obvious this method can be used for healthy machine if,  $r_{ds}=r_{qs}=r_s$ ,  $L_{ds}=L_g=L_g=L_s=1.5L_{ms}$ ,  $M_d=M_q=1.5L_{ms}$  and faulty machine if,  $r_{ds}=r_{qs}=r_s$ ,  $L_{ds}=L_{ls}+1.5L_{ms}$ ,  $L_{qs}=L_{ls}+0.5L_{ms}$ ,  $M_d=1.5L_{ms}$ ,  $M_d=1.5L_{ms}$ . The proposed method is based on indirect RFOC and direct RFOC methods.

1286 □ ISSN: 2088-8708

In RFOC strategy it is necessary that the motor equations transfer to the rotating reference frame. For this purpose, the transformation matrix as shown in (2) is used [1]:

$$\begin{bmatrix} r^e \\ s \end{bmatrix} = \begin{bmatrix} \cos \theta_e \\ -\sin \theta_e \end{bmatrix} = \begin{bmatrix} \sin \theta_e \\ \cos \theta \end{bmatrix}$$
 (2)

In (2), superscript "e" indicates the equations are in the rotating reference frame. Also, " $\theta_e$ " is the angle between the stationary reference frame and rotating reference frame. Using (2), the equations of IM (Equation (1)), can be obtained as (3) and (4):

$$\begin{bmatrix} \mathbf{V}_{ds}^{\ell} \\ \mathbf{V}_{qs}^{\ell} \\ 0 \\ 0 \end{bmatrix} = \begin{bmatrix} \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} + \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} & -\omega_{e} \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} & \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} & -\omega_{e} \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} \\ \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} + \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} & \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} & \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} \\ \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} & -(\omega_{e} - \omega_{e}) \mathbf{I}_{r} \\ \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} & -(\omega_{e} - \omega_{e}) \mathbf{I}_{r} \\ \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} \\ \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} & \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} \\ \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} & \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{I}_{qs} \end{pmatrix}}_{2} \frac{d}{dt} \\ \underbrace{\begin{pmatrix} \mathbf{I}_{ds} + \mathbf{$$

$$+\underbrace{\begin{bmatrix} \frac{\left(r_{ds}-r_{qs}\right)}{2} + \frac{\left(L_{ds}-L_{qs}\right)}{2} & \omega_{e} & \frac{\left(L_{ds}-L_{qs}\right)}{2} & \frac{\left(M_{d}-M_{q}\right)}{2} & \omega_{e} & \frac{\left(M_{d}-M_{q}\right)}{2} \\ \omega_{e} & \frac{\left(L_{ds}-L_{qs}\right)}{2} & -\frac{\left(r_{ds}-r_{qs}\right)}{2} & \frac{\left(L_{ds}-L_{qs}\right)}{2} & dt \\ \omega_{e} & \frac{2}{2} & \frac{dt}{2} & \frac{\left(M_{d}-M_{q}\right)}{2} & \frac{d}{2} & dt \\ \frac{\left(M_{d}-M_{q}\right)}{2} & \frac{d}{dt} & \left(\omega_{e}-\omega_{e}\right) & 0 & 0 \\ \frac{\left(\omega_{e}-\omega_{e}\right)}{2} & \frac{\left(M_{d}-M_{q}\right)}{2} & 0 & 0 \\ \frac{\left(\omega_{e}-\omega_{e}\right)}{2} & -\frac{\left(M_{d}-M_{q}\right)}{2} & 0 & 0 \\ \frac{\left(\omega_{e}-\omega_{e}\right)}{2} & \frac{\left(\omega_{e}-\omega_{e}\right)}{2} & 0 & 0 \\ \frac{\left(\omega_{e}-\omega_{e}\right)}{2} & 0 & 0 \\ \frac{\left(\omega_{e}-\omega_{e}\right)}{2} & 0 & 0 & 0 \\ \frac{\left(\omega_{e}-\omega_{e}\right)}{2} & 0 &$$

Where,

$$\begin{bmatrix} \vec{i}_{ch}^{*a} \\ \vec{i}_{ch}^{*a} \\ \vec{i}_{ch}^{*a} \end{bmatrix} = \begin{bmatrix} \cos \theta_{a} & \sin \theta_{a} & 0 & 0 \\ -\sin \theta_{a} & \cos \theta_{a} & 0 & 0 \\ \cos \theta_{a} & -\sin \theta_{a} & 0 & 0 \\ \sin \theta_{a} & \cos \theta_{a} & 0 & 0 \end{bmatrix} \begin{bmatrix} i_{ch}^{*} \\ i_{ch}^{*a} \\ i_{ch}^{*a} \end{bmatrix}$$

$$\begin{bmatrix} \vec{i}_{ch}^{*a} \\ \vec{i}_{ch}^{*a} \\ \vec{i}_{ch}^{*a} \end{bmatrix} = \begin{bmatrix} 0 & 0 & \cos \theta_{a} & \sin \theta_{a} \\ 0 & 0 & -\sin \theta_{a} & \cos \theta_{a} \\ 0 & 0 & \cos \theta_{a} & -\sin \theta_{a} \end{bmatrix} \begin{bmatrix} i_{ch}^{*} \\ i_{ch}^{*a} \\ i_{ch}^{*a} \\ i_{ch}^{*a} \end{bmatrix}$$

$$\begin{bmatrix} \vec{i}_{ch}^{*a} \\ \vec{i}_{ch}^{*a} \\ 0 & 0 & \sin \theta_{a} & \cos \theta_{a} \end{bmatrix} \begin{bmatrix} i_{ch}^{*a} \\ i_{ch}^{*a} \\ i_{ch}^{*a} \\ i_{ch}^{*a} \end{bmatrix}$$

$$\begin{bmatrix} \vec{i}_{ch}^{*a} \\ \vec{i}_{ch}^{*a} \\ \vec{i}_{ch}^{*a} \\ \vec{i}_{ch}^{*a} \end{bmatrix}$$

$$\begin{bmatrix} \vec{i}_{ch}^{*a} \\ \vec{i}_{ch}^{*a} \\ \vec{i}_{ch}^{*a} \end{bmatrix}$$

In (3), " $\omega_e$ " is the angular velocity of the rotor field oriented reference frame. As it is seen from (3), in general, Equation (3) includes two set of equations (forward equations: superscript "+e" and backward equations: superscript "-e"). Each of equations represents an equation where rotates in the forward or backward direction as shown in Figure 2.




Figure 2. (a): Forward and stationary reference frames (superscript "+e": forward, superscript "s": stationary), (b): Backward and stationary reference frames (superscript "-e": backward, superscript "s": stationary)

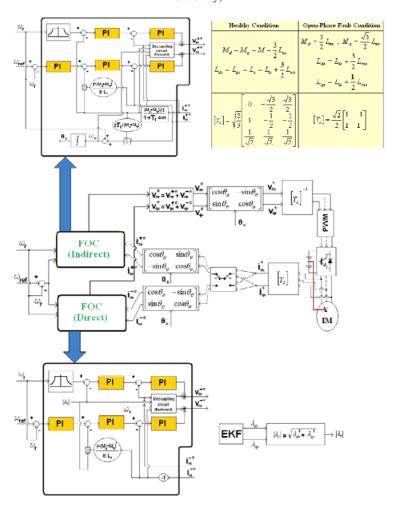


Figure 3. Block diagram of proposed method for vector control of healthy and faulty machines

A Novel Method for Vector Control of Faulty Three-Phase IM Drives Based on FOC... (Mohammad Jannati)

As it is seen from (3), the structure of the forward and backward equations are similar to the RFOC equations of healthy three-phase IM. Consequently, it is possible to control faulty machine using two developed RFOC algorithms. The block diagram of proposed RFOC for vector control of faulty machine is shown in Figure 3. In this figure, an indirect RFOC algorithm and a direct RFOC algorithm are used to control faulty IM (indirect RFOC algorithm to control forward equations and direct RFOC algorithm to control backward equations). In Figure 3, in order to alternately switched between the forward and backward states, a switch is used whereby this switch will consecutively change positions in each sampling time. It can be noted that this figure can be used for both healthy and faulty three-phase IMs. The parameters of motor which are needed to be changed from healthy mode are shown in Figure 3.

In the proposed scheme for vector control of faulty machine an Extended Kalman Fizer (EKF) is used to estimate the rotor flux in the direct RFOC. For the purpose of rotor flux estimation, the d-axis and qaxis of stator currents as well as d-axis and q-axis of rotor fluxes are chosen as the state variables. Using these state variables, it is possible to express the state space model in the form of Equation (5) and (6):

$$\dot{x} = Ax + Bu \tag{5}$$

$$y = Cx \tag{6}$$

In these equations, x, y and u are the system state matrix, system output matrix and system input matrix. Also, A, B and C are the system, input and output matrices respectively. The matrices of x, y, u, A, Band C in equations (5) and (6) are given as follows:

$$x = \begin{bmatrix} i_{ds} & i_{qs} & \lambda_{dr} & \lambda_{qr} \end{bmatrix}^T$$
(7a)

$$y = \begin{bmatrix} i_{ds} & i_{ds} \end{bmatrix}^T \tag{7b}$$

$$u = \begin{bmatrix} v_{ds} & v_{qs} \end{bmatrix}^T \tag{7c}$$

$$u = \begin{bmatrix} v_{ds} & v_{qs} \end{bmatrix}^T$$

$$u = \begin{bmatrix} 1 & -\omega_r dt & 0 & 0 \\ \omega_r dt & 1 & 0 & 0 \\ 0 & -\omega_r \frac{\left(M_d - M_q\right)}{2} dt & 1 & 0 \\ \omega_r \frac{\left(M_d - M_q\right)}{2} dt & 0 & 0 & 1 \end{bmatrix}$$
(7c)

$$B = \begin{bmatrix} 0 & 0 & 0 & 0 \\ 0 & 0 & 0 & 0 \end{bmatrix}^{T} \tag{7e}$$

$$C = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \end{bmatrix} \tag{7f}$$

The steps 10 the EKF algorithm can be formulated as [15]:

1) Estimation of the Error Covariance Matrix:

$$P(n+1) = \Gamma(n)P(n)\Gamma^{T}(n) + Q$$
(8)

2) Computation of Kalman Filter Gain:

$$K(n) = P(n+1)\Delta^{T}(n)[\Delta(n)P(n+1)\Delta(n) + R]^{-1}$$
(9)

3) Update of the Error Covariance Matrix:

$$P(n) = [1 - K(n) \land (n)] P(n+1)$$
(10)

4) State Estimation:

$$\hat{x}(n+1) = \hat{x}(n) + K(n)[z(n+1) - h(\hat{x}(n+1))]$$
(11)

In these equations, P, Q and R are the covariance matrices of the noises. To begin the calculation, the initial values of the state variables and error covariance matrices need to be identified. In this work, the initial values of matrices P, Q and R for estimation of rotor flux are obtained from the trial and error process.

## 22

#### SIMULATION RESULTS AND COMPARISIONS

In this section simulation results for 475Watt star-connected three-phase IM is carried out to validate the proposed control strategy. The simulation investigation is mainly focused on the motor speed and torque responses. Two different cases using Matlab/M-File software are simulated:

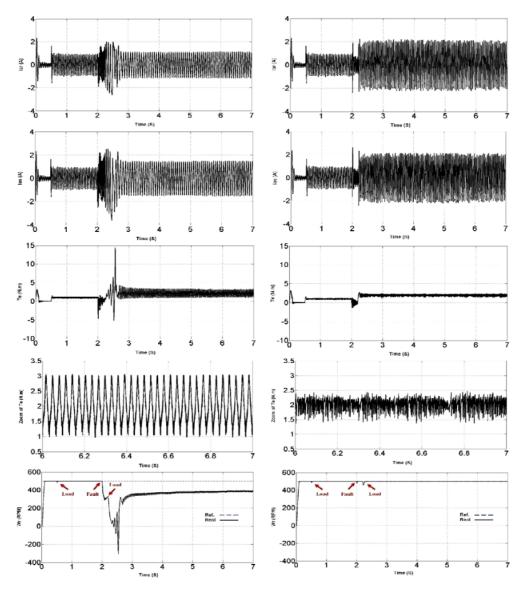


Figure 4. Simulation results of the conventional (left) and proposed (right) methods for vector control of healthy and faulty three-phase IMs; from top to bottom: Rotor a-axis current, Stator a-axis current,

Electromagnetic torque, Zoom of electromagnetic torque, Speed

1290 ISSN: 2088-8708

1) Figure 4(left): vector control of healthy and faulty three-phase IMs drive based on conventional IRFOC (the conventional IRFOC method based on voltage controller has been fully discussed in [1]).

2) Figure 4(right): vector control of healthy and faulty three-phase IMs drive based on Figure 3 (proposed FOC).

Runge-K21 algorithm is used for solving the healthy and faulty three-phase IMs dynamic equations. An IM is fed from a Sine Pulse Width Modulation (SPWM) VSI. In the simulation the reference speed is 500rpm. In this paper it is assumed an immediate open-phase fault detection. The ratings and parameters of the simulated motor are:

$$v=125V~,~f=50HZ~,~P=4~,~r_s=20.6\Omega~,~r_r=19.15\Omega$$
 
$$L_{ls}=0.0814~,~L_{lr}=0.0814H~,~L_{ms}=0.851H~,~power=475W$$

In Figure 4, it is supposed that the open-phase fault happened at t=2s (from t=0s to t=2s→healthy condition and from t=2s to t=7s→faulty condition). In this test, the value of the load is: from t=0s to t=0.5s,  $T_{l}\!\!=\!\!0N.m; \ from \ t\!\!=\!\!0.5s \ to \ t\!\!=\!\!2s, \ T_{l}\!\!=\!\!1N.m; \ from \ t\!\!=\!\!2.2s, \ T_{l}\!\!=\!\!0N.m; \ from \ t\!\!=\!\!2.2s \ to \ t\!\!=\!\!7s, \ T_{l}\!\!=\!\!2N.m. \ Based$ on Figure 4(left), simulation results of the conventional contro 12 confirm that the conventional controller is unable to control the faulty IM correctly. It can be seen that from the presented simulation results that the dynamic performance of the proposed fault-tolerant controller is acceptable. As can be seen from Figure 4(right), the proposed FOC method produces fewer ripples in the speed and torque responses. As can be seen by using conventional controller, the electromagnetic torque oscillation at steady state is about 1N.m at an average amount of 2N.m but by using proposed controller, the electromagnetic torque oscillation reduced notably by about 0.3N.m at an average amount of 2N.m. Simulation results show the better performance of the proposed technique for vector control of faulted machine in both transient and steady state.

In this paper, a vector control strategy for star-connected three-phase IM drives under open 24 se fault based on RFOC is proposed and simulated. It was shown that the faulty machine equations in the rotating reference frame can be classified as two set of balanced equations (forward and backward equations). ased on this, a novel vector control technique using two developed RFOC algorithms was proposed. The results show the good performance of the proposed drive system

# REFERENCES

- 28 as, "Vector Control of AC Machines," Oxford science publication, 1990.
- [2] M. E. H. Benbouzid, et al., "Advanced fault-tolerant control of induction-motor drives for EV/HEV traction applications: From conventional to modern and intelligent control techniques," IEEE Transactions on Vehicular Technology, Vol. 56, pp. 519-528, 2007.
- [3] A. Raisemche, et al., "Two active fault-tolerant control schemes of induction-motor drive in EV or HEV," IEEE Transactions on Vel 5 vlar Technology, Vol. 63, pp. 19-29, 2014.
- [4] M. Jannati, et al., 2 Todeling and RFOC of faulty three-phase IM using Extended Kalman Filter for rotor speed estimation," In 8th International Power Engineering and Optimization Conference (PEOCO), pp. 270-275, 2014.
- [5] A. Sayed-Ahmed and N.A. Demerdash, "Fault-Tolerant Operation of Delta-Connected Scalar- and Vector-Controlled AC Motor Drives," IEEE Transactions on Power Electronics, Vol. 27, pp. 3041-3049, 2012.
- [6] H. S. Che, et al., "Current control methods for an asymmetrical six-phase induction motor drive," IEEE Transactions on Poter Electronics, Vol. 29, pp. 407-417, 2014.

  A. Gaeta, et al., "Modeling and control of three-phase PMSMs under open-phase fault," IEEE Transactions on
- Industry Applications, Vol. 49, pp. 74-83, 2013.
- [8] M. Tani, et al., "Control of multiphase induction motors with an odd number of phases under opencircuit phase faults," IEEE Transactions on Power Electronics, Vol. 27, pp. 565-577, 2012.
- [9] A. Gaeta, et al., "Sensorless vector control of PM synchronous motors during single-phase open-circuit faulted conditions," IEEE Transactions on Industry Applications, Vol. 48, pp. 1968-1979, 2012.
- [10] Y. Zhao and T. A. Lipo, "Modeling and control of a multi-phase induction machine with structural unbalance," IEEE Transactions on Energy Conversion, Vol. 11, pp. 570-577, 1996.
- [11] H. M. Ryu, et al., "Synchronous-frame current control of multiphase synchronous motor under asymmetric fault condition due to open phases," IEEE Transaction on Industrial Applications, Vol. 42, pp. 1062-1070, 2006.
- [12] S. Dwari and L. Parsa, "Fault-tolerant control of five-phase permanent-magnet motors with trapezoidal back EMF," IEEE Transactions on Industrial Electronics, Vol. 58, pp. 20-485, 2011.
- [13] Z. Yifan and T.A. Lipo, "An approach to modeling and field-oriented control of a three phase induction machine with structural imbalance," In Proc. APEC, San Jose, TX, pp. 380-386, 1996.

	IJECE	ISSN: 2088-8708	
--	-------	-----------------	--

- [14] M. Jannati, et al., "Speed Sensorless Vector Control of Unbalanced Three-Phase Induction Motor with Adaptive Sliding Mode Control," *International Journal of Power Electronics and Drive Systems (IJPEDS)*, Vol. 4, pp. 406-418, 2014.
- [15] M. Jannati, et al., "Speed 17 sorless Fault-Tolerant Drive System of 3-Phase Induction Motor Using Switching Extended Kalman Filter," TELKOMNIKA Indonesian Journal of Electrical Engineering, Vol. 12, pp. 7640-7649, 2014
- [16] L. Tian-Hua, et al., "A strategy for improving reliability of field-oriented controlled induction motor drives," IEEE Transaction on Industrial Applications, Vol. 29, pp. 910-918, 1993.

# A Novel Method for Vector Control of Faulty Three-Phase IM Drives Based on FOC Method

**ORIGINALITY REPORT** 

11% SIMILARITY INDEX

#### PRIMARY SOURCES

- Shih-Chin Yang, Guan-Ren Chen, Da-Ren Jian. "On-Line Stator Open-Phase Fault Detection and Tolerant 20 words 1 % Control for Permanent Magnet Machines Using the Neutral Point Voltage", IEEE Access, 2017
- "2014 IEEE 8th International Power Engineering and Optimization Conference (PEOCO2014) [Proceedings abstracts]", 2014 IEEE 8th International Power Engineering and Optimization Conference (PEOCO2014), 2014

  Crossref
- E. Prasad, A. Sudhakar, Vijay Kumar. "Simulation of five-level inverter fed PMSM based on fast SVPWM", 2012 IEEE International Conference on Power Electronics, Drives and Energy Systems (PEDES), 2012  $_{\text{Crossref}}$
- 4 H.A. Toliyat. "A self reconfigurable electric motor controller for hybrid electric vehicle applications", IECON 03 29th Annual Conference of the IEEE Industrial Electronics Society (IEEE Cat No 03CH37468) IECON-03, 2003  $_{\text{Crossref}}$
- www.deepdyve.com

K.W. Lim. "Torque ripple minimization in PM synchronous motor using iterative learning control", 15 words — 1% IECON 99 Conference Proceedings 25th Annual Conference of the IEEE Industrial Electronics Society (Cat No 99CH37029) IECON-99, 1999

Crossref

- Min-Ho Park. "High performance current regulator for a field-oriented controlled induction motor drive", Conference Record of the 1992 IEEE Industry Applications Society Annual Meeting, 1992

  Crossref
- M.A. Rahman. "<![CDATA[Dynamic Performance Analysis of Permanet Magnet Synchronous Motors Magnet Synchronous Motors]]>", IEEE Transactions on Power Apparatus and Systems, 6/1984


  Crossref
- 9 www.osti.gov Internet 13 words — < 1%
- Yoon-Ho Kim, Yoon-Sang Kook. "High performance IPMSM drives without rotational position sensors using reduced-order EKF", IEEE Transactions on Energy Conversion, 1999 Crossref
- journals.ametsoc.org 12 words < 1%
- 12 A.H. Besheer, H.M. Emara, M.M. Aziz. "An LMI Approach to Fuzzy pole cluster for Regulating Wind Energy Conversion System", 2006 IEEE PES Power Systems Conference and Exposition, 2006 Crossref

13	pt.scribd.com Internet	11 words — <b>&lt;</b>	1%
14	B. Akin. "Simple Derivative-Free Nonlinear State Observer for Sensorless AC Drives", IEEE/ASME Transactions on Mechatronics, 10/2006 Crossref	10 words — <b>&lt;</b>	1%
15	Chuan-Feng Fang. "Adaptive speed control of AC servo induction motors with on-line load estimation", Proceedings of 1994 American Control - ACC 94 ACC-94, 1994  Crossref		1%
16	dspace.cuni.cz Internet	10 words — <b>&lt;</b>	1%
17	www.sci-int.com Internet	10 words — <b>&lt;</b>	1%
18	bangdarwin.files.wordpress.com	9 words — <b>&lt;</b>	1%
19	B. Robyns, H. Buyse, F. Labrique. "Fuzzy logic based field orientation in an indirect FOC strategy	8 words — <b>&lt;</b>	1%

B. Robyns, H. Buyse, F. Labrique. "Fuzzy logic based field orientation in an indirect FOC strategy of an induction actuator", Mathematics and Computers in Simulation, 1998

Crossref

Emil Levi, Martin Jones, Slobodan N. Vukosavic, Atif 8 words — < 1 % Iqbal, Hamid A. Toliyat. "Modeling, Control, and Experimental Investigation of a Five-Phase Series-Connected Two-Motor Drive With Single Inverter Supply", IEEE Transactions on Industrial Electronics, 2007

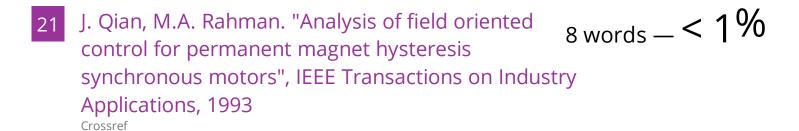

- Koubaa, Y.. "Asynchronous machine parameters estimation using recursive method", Simulation Modelling Practice and Theory, 200610

  Crossref 8 words -<1%
- Kuo-Kai Shyu, Faa-Jeng Lin, Hsin-Jeng Lin, Bor-Sen Juang. "Robust variable structure speed control for induction motor drive", IEEE Transactions on Aerospace and Electronic Systems, 1999 Crossref
- Xiaozhong Liao. "Speed sensor-less control of an induction motor with rotor flux tracking at very low speed", The Fifth International Conference on Power Electronics and Drive Systems 2003 PEDS 2003 PEDS-03, 2003 Crossref
- www.aedie.org 8 words < 1%
- O. Ojo, M. Vipin, I. Bhat. "Steady-State Performance Evaluation of Saturated Field Oriened  $^{7}$  words <1% Induction Motors", IEEE Transactions on Industry Applications, 1994 Crossref
- R. A. Gupta, Rajesh Kumar, Borra Suresh Kumar. Twords 7 words 1 % "Direct Torque Controlled Induction Motor Drive with Reduced Torque Ripple", 2006 IEEE International Conference on Industrial Technology, 2006 Crossref

- F. Zidani, M. El Hachemi Benbouzid, D. Diallo, M.S. Nait-Said. "Induction motor stator faults diagnosis by a current concordia pattern-based fuzzy decision system", IEEE Transactions on Energy Conversion, 2003

  Crossref
- Hui Liu, Ke Ma, Poh Chiang Loh, Frede Blaabjerg.  $_{\rm Crossref}$  1 Words < 1 %  $_{\rm Crossref}$  6 words < 1 %  $_{\rm Crossref}$  6 words < 1 %

EXCLUDE QUOTES OFF
EXCLUDE BIBLIOGRAPHY OFF

**EXCLUDE MATCHES** 

OFF